

# Differential Skid Plate Kit

Chevy HD 2500 | 2011-2016

Part #: 121251

Rev. 122724




491 W. Garfield Ave., Coldwater, MI 49036 • Phone: 517-279-2135

Web/live chat: [www.bds-suspension.com](http://www.bds-suspension.com) • E-mail: [tech-bds@ridefox.com](mailto:tech-bds@ridefox.com)

## SAFETY WARNING

BDS Suspension Co. recommends this system be installed by a professional technician. In addition to these instructions, professional knowledge of disassembly/ reassembly procedures and post installation checks must be known.


Box Kit		
Part #	Qty	Description
02967	1	2011 Chevy HD 3" Diff Skid Plate
02968	1	2011 Chevy HD 3" Splash Shield
B1164	1	Bag Kit
	1	BDS Badge
	4	3/8 USS Flat Washer - Zinc
	4	3/8 - 16 x 1 Type 23 Self Tap
978	1	Bolt Pack
	2	1/4"-20 x 3/4" BHSCS - Stainless Steel
	2	1/4" SAE Washer - Clear Zinc
	2	1/4"-20 Nylock Nut - Clear zinc

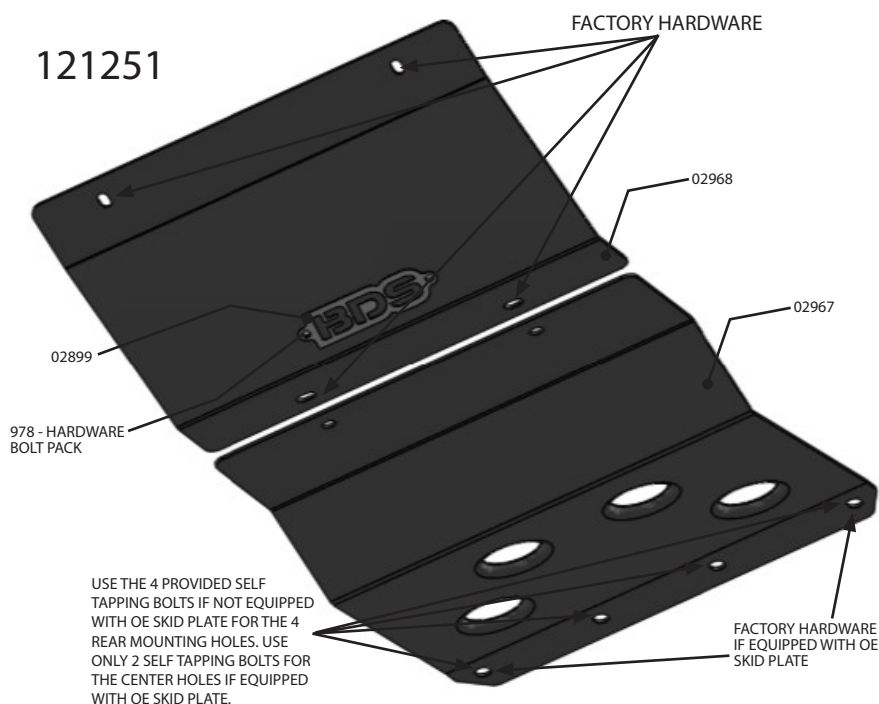

## INSTALLATION INSTRUCTIONS

1. Park vehicle on clean, flat, and level surface. Set the parking brake.
2. Remove the factory splash shield and factory differential skid plate. qty 8 - 15mm Bolts from both skid plates. Retain all HW. (Fig. 1, 2)

**FIGURE 1**

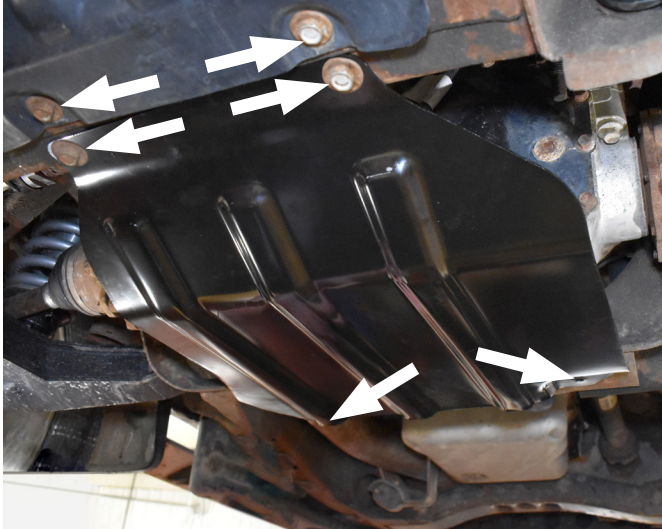

**FIGURE 2**



3. Bolt the BDS logo onto the splash guard with hardware from #978, the washer goes with the 7/16" nut on the backside. Do not put a washer on the 5/32" button head side. Tighten to 18 ft-lbs. (Fig. 3)

**FIGURE 3**




4. Install front splash guard to the front most holes first, leave them loose. (Fig. 4)

**FIGURE 4**




5. Place skid plate under the rear of the splash guard, installing the OE bolts through the splash guard, skid plate then into the cross member. Install both bolts and leave loose. (Fig. 5)

**FIGURE 5**

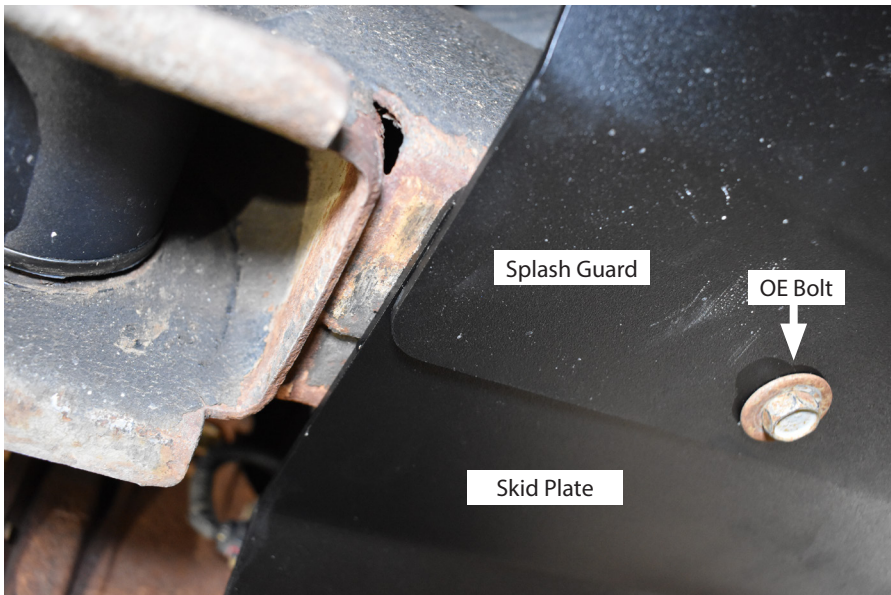

6. If not equipped with rear factory skid plate use the provided 4 self tapping bolts in the existing crossmember holes. If equipped with factory skid plate, re- use the 2 OE bolts in the 2 outside holes and 2 self tapping bolts for the 2 inside holes. (Fig. 6)

**FIGURE 6**

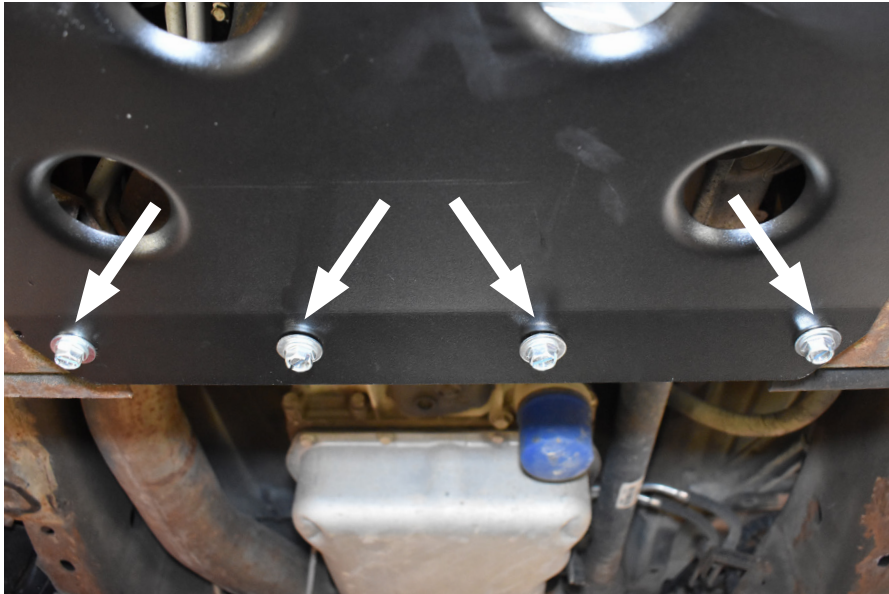

7. Tighten all hardware.
8. Re-Check and tighten at 500 miles.